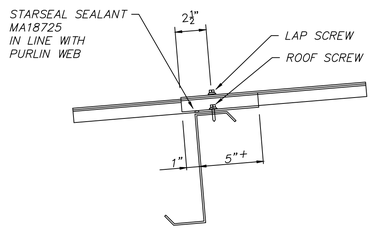

ENDLAP DETAIL

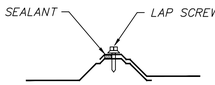

SIDELAP DETAIL

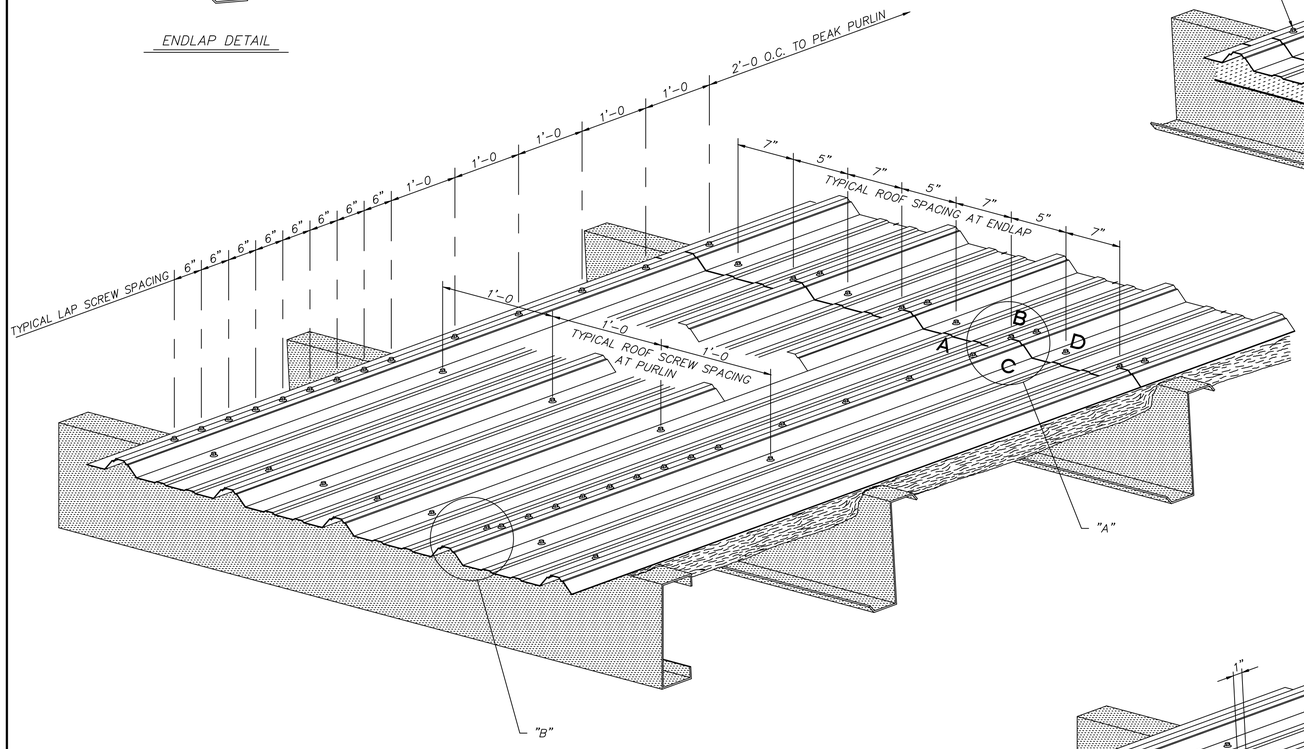

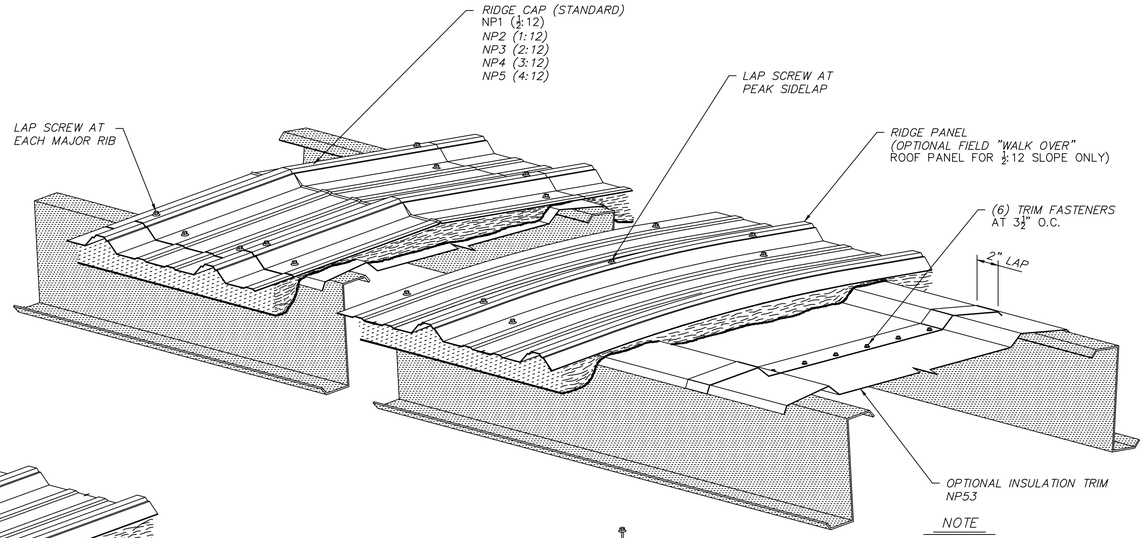

NOTE

1. INSULATION NOT BY STAR.
2. INSTALL AS INSULATION AND ROOF SHEETING IS BEING APPLIED. TEMPORARY ATTACHMENT, IF REQUIRED, NOT BY STAR.

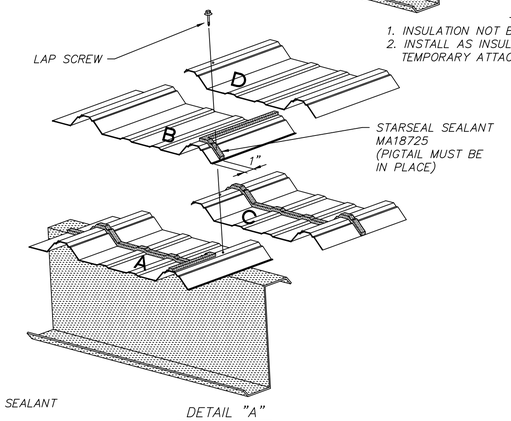

DETAIL "A"

TYPICAL LAP DETAIL

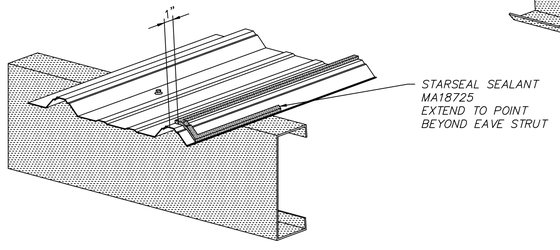

DETAIL "B"

NOTE:

1. THE FASTENER SPACINGS SHOWN ON THIS DRAWING ARE NOT INTENDED FOR UL–90 RATED ROOFS. IF THE ROOF IS SPECIFIED AND ORDERED AS UL–90, USE FASTENER SPACING SHOWN ON DRAWING 35.02, TITLED "STAROOF–90* CONSTRUCTION DETAILS".
2. STAR BUILDING SYSTEMS IS NOT RESPONSIBLE FOR FASTENER SHORTAGES CAUSED BY USING THE WRONG FASTENER SPACING.
3. ROOF AND WALL PANELS SHOULD BE CLEANED OF ANY DRILL SHAVINGS OR FIELD CUTTING FILINGS AT THE END OF EACH DAY TO PREVENT RUSTING OF THESE PARTICLES.
4. DURA–RIB ROOF PANEL MUST BE ATTACHED TO PURLIN STRUTS INDICATED —X— OR ←X→ WITH THE SAME SPACING AS USED ON STANDARD ROOF PURLINS.

STAROOF–30 * CONSTRUCTION DETAILS	35.01.09
	09/22/02

Revision	Date	Description	By	Ck'd

STAR BUILDING SYSTEMS
An NCI Company

P.O. BOX 94910
OKLAHOMA CITY, OK 73143
(405) 636–2010

Project Name & Location:
PINNACLE CASINO –
MANHATTAN CONSTRUCTION
BATON ROUGE, LA

Customer:
CASEY CIVIL LLC
COMMERCIAL
MANDEVILLE, LA

Drawing Status:
☐ Preliminary (Not For Construction)
☐ For Approval (Not For Construction)
☐ For Construction Permit
☒ For Erector Installation

Scale: NOT TO SCALE
Drawn by:
Checked by:
Project Engineer:
Job Number: 12–B–63841
Sheet Number: R4 of 10

The engineer whose seal appears hereon is an employee for the manufacturer for the materials described herein. Said seal or certification is limited to the products designed and manufactured by manufacturer only. The undersigned engineer is not the overall engineer of record for this project.