



Designation: D 5822 – 023

Standard Test Method for Determining Seam Strength in Inflatable Restraint Cushions¹

This standard is issued under the fixed designation D 5822; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (ϵ) indicates an editorial change since the last revision or reapproval.

1. Scope

1.1 This test method covers the measurement of seam efficiency and the maximum-sewn seam strength which can be achieved in inflatable restraint cushions composed of woven fabrics when a force is applied perpendicular to the seam. The seam, using a grab test procedure in Test Method D 1683, which is used to measure breaking force and elongation in sewn seams of woven fabrics, shall be used in conjunction with this test method for measuring seam strength. test. For evaluating sewing thread, refer to Test Method D 204.

1.2 This test method is restricted to sewn seams that are obtained from a previously sewn driver or passenger side cushion. an inflatable restraint cushion. Seams may include but are not limited to sewn, OPW, glued, fused (chemically or thermally).

1.3 This test method is used when the measurement of a resistance to a specified force, a breaking force, a minimum elongation, or a combination thereof are required to determine the sewn seam strength, seam slippage, or seam integrity of a particular fabric for inflatable restraint use.

1.4 Procedures and apparatus other than those stated in this standard may be used by agreement between purchaser and supplier with the specific deviations from the standard acknowledged in the report.

1.5 The values stated in either SI units or inch-pound units are to be regarded separately as standard. The values stated in each system are not exact equivalents; therefore, each system must be used independently of the other.

1.6 *This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.*

¹ This test method is under the jurisdiction of ASTM Committee D13 on Textiles and is the direct responsibility of Subcommittee D13.20 on Inflatable Restraints. Current edition approved April 10, 2002³. Published June 2002; November 2003. Originally published as D 5822-95; approved in 1995. Last previous edition approved in 2002 as D 5822 – 002.

2. Referenced Documents

2.1 *ASTM Standards:*²

D 123 Terminology Relating to Textiles

D 204 Test Methods for Sewing Threads

² For referenced ASTM standards, visit the ASTM website, www.astm.org, or contact ASTM Customer Service at service@astm.org. For *Annual Book of ASTM Standards*, Vol 07.01, volume information, refer to the standard's Document Summary page on the ASTM website.

D-1683 Test Method 1776 Practice for Failure in Sewn Seams of Woven Fabrics³ Conditioning and Testing Textiles
D 673990 Terminology Relating to Inflatable Restraints

3. Terminology

3.1 Definitions:

3.1.1 *seam efficiency, n*— *in inflatable restraints*, the ratio of seam strength to fabric strength.

3.1.2 *seam failure, n*— *in inflatable restraints*, the point at which an external force ruptures a seam assembly or the fabric, or causes excessive yarn slippage adjacent to the seam assembly.

3.1.3 *seam strength, n*— *in inflatable restraints*, the maximum force required to create a seam failure.

3.2 For definitions of textile terms relating to inflatable restraints used in this standard, refer to Terminology D 3990.

3.3 For definitions of other textile terms used in this standard, refer to Terminology D 123 and Terminology D 6799. D 123.

4. Summary of Test Method

4.1 Grab-type test specimens containing seams

4.1 Specimens with and without seam assemblies taken from inflatable restraint cushions at specified seam locations are destructively tested in a tensile testing machine under laboratory conditions to determine seam strength and seam efficiency.

5. Significance and Use

5.1 In inflatable restraints, the method of creating a seam includes, but is not limited to, sewing, weaving, bonding and welding.

5.2 Seam

5.1 Seam strength testing is used for design validation and for lot acceptance.

5.32 This test method constitutes the conditions, procedures, and equipment by which inflatable restraints are tested for seam strength and seam efficiency. It is intended to be used as a guideline in establishing a written part specification or print. The specification or agreement of purchaser and supplier may deviate from the procedures described herein when (based on experience) considerations of equipment, cushion design, or other factors dictate otherwise.

5.3 In cases of dispute arising from differences in reported test results when using this test method for acceptance testing of commercial shipments, the purchaser and the supplier should perform comparative tests to determine if there is a statistical bias between their laboratories. Competent statistical assistance is recommended for the investigation of bias. As a minimum, the two parties should take a group of test specimens from the same lot of fabric to be evaluated, which utilize a like seam assembly (or standard seam assembly) to achieve seam interaction. The test specimens should then be randomly assigned in equal numbers to each laboratory for testing. If a bias is found, either its cause must be determined and corrected, or the purchaser and supplier must agree to interpret future test results in light of the known bias.

5.4 Test Method D 5822 is a reliable test method but procedures which may require special attention are identified in the precision and bias section of this test method.

6. Apparatus

6.1 *Tensile Testing Machine*, either a constant-rate-of-extension (CRE) of the CRE, CRL or a constant-rate-of-traverse (CRT) type, that is CRT type conforming to Specification D 76, with respect to force indication, working range, capacity, and elongation indicator, and designed for the tensile forces anticipated, that is operated operation at a rate speed of 300 ± 10 mm/min (12 ± 0.5 in./min), that has in./min); or, a force range selected such that the anticipated break occurs between 10% and 90% variable speed drive, change gears, or interchangeable weights as required to obtain a 20 ± 3 -s time-to-break (see 12.4). The constant-rate-of-extension type of full-scale load, tensile testing machine is preferred in this test method.

6.2 *Clamp and that has Jaw Faces*, adjustable clamps compatible with tensile testing machine, the jaws of which have smooth, flat, metallic gripping surfaces parallel to each other.

6.2.1 Each clamp shall have a front (or top) jaw face measuring 25 ± 1 mm (1.0 ± 0.02 in.) perpendicular to the direction of the application of the force, and not less than 25 nor more than 50 mm (1.0 nor more than 2.0 in.) parallel to the direction of the application of the force. The back, or bottom, jaw face of each clamp shall be at least as large as its mate. Use of a larger face for the second jaw reduces the problem of front and back jaw misalignment.

NOTE 1—Front (or top) faces measuring 25 by 50-mm (1.0 by 2.0 -in.) will not necessarily give the same value as agreed upon 25 by 25-mm (1.0 by 1.0 -in.) faces. For many materials, the former are preferable because of the larger gripping area which tends to reduce slippage. While both sizes of gripping surface are permitted, the face sizes used must be the same for all samples in the test and must be recorded in the report.

6.2.2 At least one clamp should be supported by a free swivel or universal joint to allow the clamp to rotate in the plane of the fabric.

6.23 For inflatable restraints, all test equipment used in accordance with this test method shall be certified for calibration annually by an independent agency or equipment manufacturer whose results are traceable to the National Institute of Science and Technology (NIST) or other national standards laboratory. The test parameters of the equipment shall be tested within the operating ranges covered in the cushion specification or equivalent document.

7. Sampling

7.1 Seam strength testing is a destructive test and therefore necessitates sampling procedures if used in conjunction with lot acceptance.

7.2 For acceptance testing, the lot size is the quantity of cushions ~~sewn produced~~ in one production day.

7.3 *Lot Sample*—For acceptance testing, take at random the number of cushions directed in an applicable cushion specification or other agreement between purchaser and supplier. Consider the cushions to be the primary sampling units.

7.4 *Seam—Containing Test Specimens*—Select portions of sampled cushions ~~constitute the test specimens~~.

7.5 Select specimens from cushions at locations on the cushion seam(s) where the greatest stresses are anticipated, containing seam assemblies as indicated directed in the an applicable cushion specification or equivalent. In seams involving woven fabric, this as agreed upon by purchaser and supplier. If seam efficiency testing is usually where the warp or filling yarns are parallel to the seam. Cushion design may indicate other stress points of concern.

7.6 Unless otherwise specified for driver-side cushions, be done, select specimens taken a portion of unseamed fabric adjacent to the sampled area, from which the seamed specimen was taken. Wherever possible, such specimens should contain the same yarns as the seam assemblies that are to be placed in the 0 rad (0°), 0.79 rad (45°), and 1.57 rad (90°) positions, relative clamps oriented parallel to the warp traverse direction of the fabric in the front panel.

7.7 For passenger-side cushions, select specimens from seam locations as directed in an applicable cushion specification or other agreement between purchaser and supplier. ~~test.~~

NOTE 12—~~A~~Specimens are usually specified to be taken from a cushion at a location on the cushion seam(s) where the greatest stresses are anticipated. In seams involving woven fabric, this is usually where the warp or filling yarns are parallel to the seam. Cushion design may indicate other stress points of concern.

NOTE 3—Use caution in selecting specimens from areas of the cushion where the seams exhibit sharp radius turns. During seam strength testing, these areas will exhibit uneven point loading at the edges of the test specimen.

NOTE 4—Unless otherwise specified for driver-side cushions, select specimens taken from the perimeter seam at the 0 rad (0°), 0.79 rad (45°), and 1.57 rad (90°) positions, relative to the warp direction of the fabric in the front panel.

7.4.1 Cut each specimen 100 ± 1 mm (4 ± 0.05 in.) wide by at least 150 mm (6 in.) long (Note 5) with the long dimension parallel to the direction of testing and force application. For seamed specimens, the seam shall be centrally located perpendicular to the application of force.

NOTE 5—The length of the specimen depends on the type of clamps being used. The specimen should be long enough to extend through the clamps and project at least 10 mm (0.5 in.) at each end. The specimen length may be calculated using Eq 1 or Eq 2:

$$\text{Specimen length, mm} = C + 2W \quad (1)$$

$$\text{Specimen length, in.} = K + 2W \quad (2)$$

where:

C = 95 mm (constant based on a gage length of 75 plus 20 mm for projections beyond the clamp),

K = 4 in. (constant based on a gage length of 3 plus 1 in. for projections beyond the clamps), and

W = jaw face width in direction of force, mm (in.).

7.4.2 To aid in aligning the specimens in the clamps of the tensile testing machine, draw vertical lines parallel to the long direction (and along a yarn of woven fabric) located 37 ± 1 mm (1.5 ± 0.02 in.) in from the edge of both sides of the specimen. The parallel lines serve as a guide to ensure that the same yarns in the direction of test are gripped in both clamps.

8. Conditioning

8.1 Conditioning of specimens for seam strength testing shall be at the standard atmosphere for testing textiles for at least 4 h prior to test, in accordance with Practice D 1776.

9. Procedure

9.1 Select and condition specimens in accordance with Sections ~~8 and 7~~ and 8 of this test method.

9.2 ~~M~~For seam assembly testing, place the specimen containing the seam ~~strength~~ assembly in the clamps with the seam towards the rear of the ~~specimens~~ machine (as shown in accordance with Test Method D 1683.

9.3 ~~On Fig. 1~~ using the test report, record vertical alignment guides, and center the seam line in the clamp faces, perpendicular to the direction of test. For seam efficiency, place the unseamed fabric specimen in the clamps using the vertical alignment guides in the clamp faces, parallel to the direction of test.

9.3 Ensure that the tension on the specimen is uniform across the clamp width.

9.4 Draw a mark across the specimen at the front inner edge of each jaw to check for specimen slippage. When slippage occurs, the mark will move away from ~~which the specimens were taken~~ jaw edge and such movement can be observed.

9.5 Operate the ~~r~~ tensile tester until partial rupture or severe yarn slippage of the specimen is observed. Record whether the mode of failure is yarn slippage or rupture, and its location.

9.6 Record the maximum seam strength or maximum fabric strength of the test specimen depending upon the type of specimen tested.

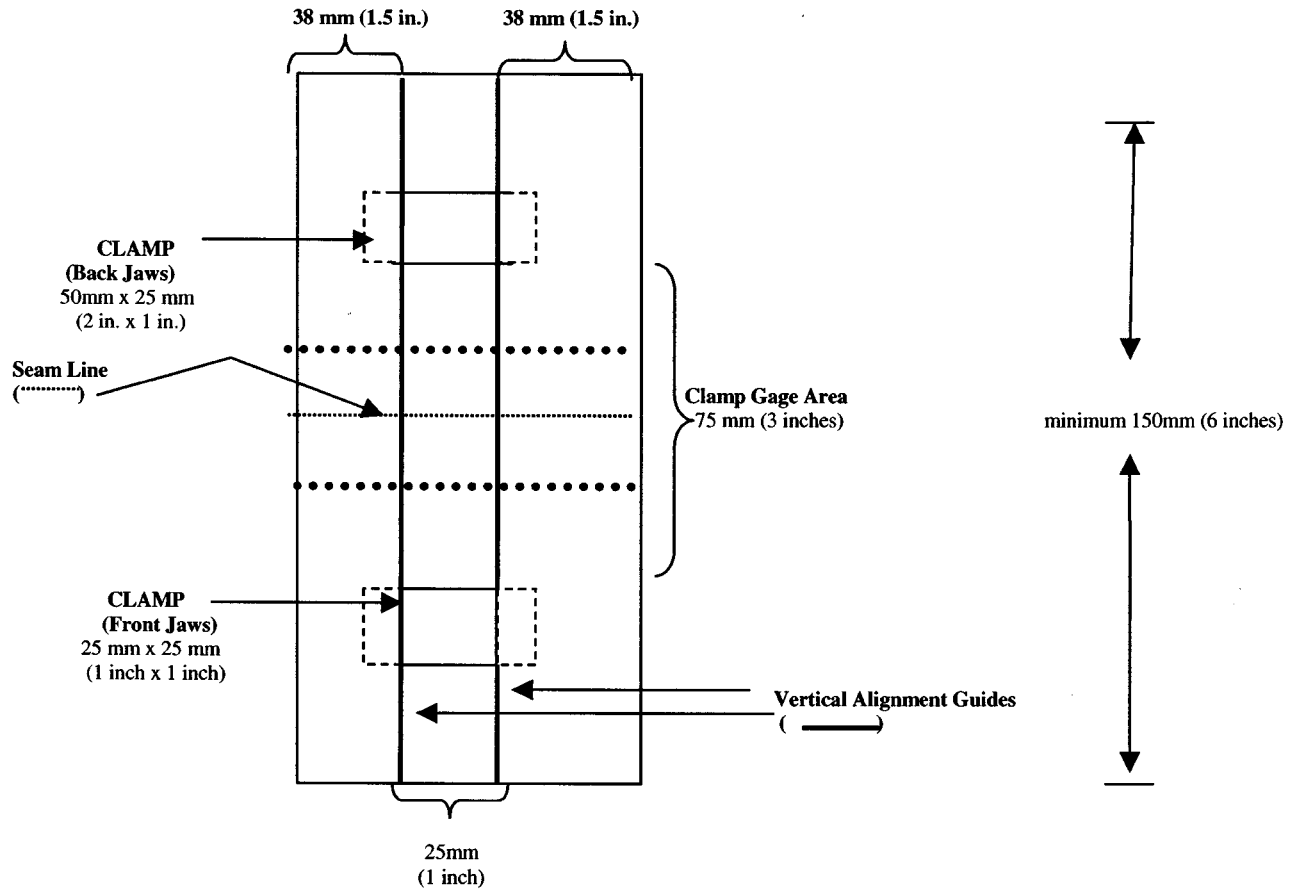


FIG. 1 Specimen Placement in Clamps
(Clamp Gage Area and Vertical Alignment Guides)

9.7 Inspect the mark previously drawn on each specimen across the jaw to check for seam slippage. No noticeable seam slippage should occur during the test.

9.8 Discard test data if the measured breaking force values are significantly below specified value or below the average value of the other specimens.

NOTE 6—The causes of such outlying data include, but are not limited to, (1) specimen slippage in jaws, (2) specimen rupture at the edge of or within the jaws, and (3) faulty operation of the tensile tester. The criteria for deciding to discard outlying test data and the method of reporting such rejection of test data should be established by purchaser and supplier. In the absence of any such agreement, these specimens and results shall be retained.

NOTE 7—When a specimen is observed to slip in the jaws, or if more than 25 % of the specimens break at a point within 5 mm (0.020 in.) of the edge of the jaw, then (1) the jaws may be padded, (2) the fabric may be coated under the jaw face area, or (3) the surface of the jaw face may be modified. If any of these modifications are used, state so in the report.

NOTE 8—It is difficult to determine the precise reason for certain specimens to break near the edge of the jaws. If such a break is caused by damage to the specimen by the jaws, then the results should be discarded. If, however, the break is due merely to randomly distributed weak places, it is a legitimate test result. In some cases, it may also be caused by a concentration of stress in the area adjacent to the jaws because the jaws prevent the specimen from contracting in width as the force is applied. In such cases, a break near the edge of the jaw is inevitable and should be accepted as a characteristic of the particular test method. This is often the case when testing fabrics using the grab procedure.

10. Report

10.1 State that Calculations

10.1 Calculate the tests were conducted in accordance with Test Method D-5822 for determining the maximum seam strength in inflatable restraints cushions:

10.1.1 If deviation from Test Method D-5822 occurred, any reference to this test method shall state: "Testing was performed in accordance with ASTM D-5822, with the following changes:"

10.2 The purchaser and supplier shall determine the exact form of the test report. Unless otherwise specified, the form shall provide the following information:

10.2.1 Cushion designation(s);

10.2.2 Lot identification;

- 10.2.3 Date of report,
- 10.2.4 Name of person certifying report,
- 10.2.5 Relevant specification,
- 10.2.6 Number of individual specimens used in each test using Eq 3:

$$S_s = kS_b/W \quad (3)$$

where:

- S_s = maximum seam strength, N (lbf),
- k = a constant equal to 1000 for SI units and the cushion location 1 for inch-pound units,
- S_b = recorded seam assembly breaking force, N (lbf), and
- W = width of the specimens used specimen in the jaws, mm (in.).

- 10.2 Determine percent seam strength test,
- 10.2.7 Tests performed and data obtained,
- 10.2.8 Laboratory conditions if other than standard, and
- 10.2.9 Deviations from standard procedures and apparatus. efficiency using Eq 4:

$$E = 100 S_s / F \quad (4)$$

where:

- E = seam efficiency, %,
- S_s = recorded seam strength, N (lbf), and
- F = fabric breaking force, N (lbf).

11. Precision and Bias

- 11.1 A precision and bias statement is contained Report
- 11.1 State that the tests were conducted in accordance with Test Method D 1683. No additional statement is made about either D 5822 for determining the precision or bias of maximum seam strength in inflatable restraints cushions.
- 11.1.1 If deviation from Test Method D 5822 occurred, any reference to this test method shall state: "Testing was performed in accordance with ASTM D 5822, with the following changes:"
- 11.2 The purchaser and supplier shall determine the exact form of the test report. Unless otherwise specified, the report shall provide the following information:
 - 11.2.1 Cushion designation(s),
 - 11.2.2 Lot identification,
 - 11.2.3 Date of report,
 - 11.2.4 Name of person certifying report,
 - 11.2.5 Relevant specification,
 - 11.2.6 Type of testing machine used,
 - 11.2.7 Maximum force obtainable in the range used for determining testing,
 - 11.2.8 Pretension if used,
 - 11.2.9 Size of jaw faces used,
 - 11.2.10 Type of padding used in the jaws, modification of specimen gripped in the jaws, or modification of jaw faces, if any,
 - 11.2.11 Cushion location of the specimens used in the seam strength test,
 - 11.2.12 Number of specimens used in each test,
 - 11.2.13 Type of test specimen,
 - 11.2.14 The average breaking force for specimens giving acceptable breaks,
 - 11.2.15 Results of the seam strength tests for each location,
 - 11.2.16 Tests performed and data obtained,
 - 11.2.17 Laboratory conditions if other than standard, and
 - 11.2.18 Deviations from standard procedures and apparatus.

12. Precision and Bias

- 12.1 Two laboratories conducted an interlaboratory test in 2002 using randomly drawn seamed and unseamed specimens (see Appendix X1). The standard fabric used was 630 denier Nylon 66, plain weave, uncoated, count 41 by 41.
- 12.2 As indicated in Appendix X1, the test procedure in Test Method D 5822 is reliable at the 95 % confidence level.
- 12.3 Variability in results using this test method can be attributed, but not restricted to, the following: (1) fabric slippage in clamps; (2) yarns not parallel to direction of test; (3) vertical alignment guides not drawn parallel to yarns; (4) jaw face misalignment; (5) the axis of the seam assembly not perpendicular to direction of force when testing. See Notes 6-8 of this test method for further discussion on controlling such variability.
- 12.4 Comparison of results from tensile testing machines operating on different principles of traverse is not recommended. When different types of machines are used for comparison testing, constant-time-to-break at 20 ± 3 s is the established way of producing data. Even then the data may differ significantly.

13. Keywords

 123.1 airbag; cushion; inflatable restraint; seam efficiency; seam failure; seam strength
APPENDIX
(Nonmandatory Information)
X1. Interlaboratory Tests
Gage R&R

 ILC 2.5
 Lab "1" Fill
 ILC D5822/D1683
 Oct. 31/02

Historic Std. Dev. = N/A

Tolerance = 1600

Gage R&R

Distinct Categories = 18

Source	VarComp	Standard Deviation	% Contribution	% Process	5.15 (SD)	% of Tolerance
Reproducibility	494.2687	22.23215	0.05 %	N/A	114.4956	7.16 %
Operator	46.65186	6.830217	0.00 %	N/A	35.17562	2.20 %
Replicate	447.6168	21.15696	0.04 %	N/A	108.9583	6.81 %
Repeatability	5768.978	75.95379	0.54 %	N/A	391.162	24.45 %
Test Portion	5768.978	75.95379	0.54 %	N/A	391.162	24.45 %
Total Gage R&R	6263.247	79.14068	0.59 %	N/A	407.5745	25.47 %
Sample	1055070	1027.166	99.41 %	N/A	5289.906	330.62 %
Total Study	1061334	1030.211	100.00 %	N/A	5305.584	331.60 %

ILC D5822/D1683

Lab "2" Fill

Oct. 31/02

Historic Std. Dev. = N/A

Tolerance = 1600

Gage R&R

Distinct Categories = 6

Source	VarComp	Standard Deviation	% Contribution	% Process	5.15 (SD)	% of Tolerance
Reproducibility	4730.233	68.77669	0.64 %	N/A	354.2	22.14 %
Operator	-1972.99	0	0.00 %	N/A	0	0.00 %
Sample Operator	4730.233	68.77669	0.64 %	N/A	354.2	22.14 %
Replicate	-999.056	0	0.00 %	N/A	0	0.00 %
Repeatability	26870.43	163.922	3.64 %	N/A	844.1984	52.76 %
Test Portion	26870.43	163.922	3.64 %	N/A	844.1984	52.76 %
Total Gage R&R	31600.66	177.7657	4.28 %	N/A	915.4936	57.22 %
Sample	706267.6	840.3973	95.72 %	N/A	4328.046	270.50 %
Total Study	737868.3	858.9926	100.00 %	N/A	4423.812	276.49 %

Gage R&R

 ILC Measurement Warp Industrial D1683
 Oct. 31, 2002

ILC 2.5

Lab "1" Warp

Historic Std. Dev. = N/A

Tolerance = 200

Distinct Categories = 20

Gage R&R

Source	VarComp	Standard Deviation	% Contribution	% Process	5.15 (SD)	% of Tolerance
Reproducibility	1276.574	35.72917	0.11 %	N/A	184.0053	92.00 %
Operator	-565.384	0	0.00 %	N/A	0	0.00 %
Replicate	1276.574	35.72917	0.11 %	N/A	184.0053	92.00 %
Repeatability	4004.655	63.28234	0.34 %	N/A	325.9041	162.95 %
Test Portion	4004.655	63.28234	0.34 %	N/A	325.9041	162.95 %
Total Gage R&R	5281.229	72.67206	0.45 %	N/A	374.2611	187.13 %
Sample	1171191	1082.216	99.55 %	N/A	5573.411	2786.71 %
Total Study	1176472	1084.653	100.00 %	N/A	5585.963	2792.98 %

ILC Measurement Warp Industrial D1683

Oct. 31, 2002

Lab "2" Warp

Historic Std. Dev. = N/A

Tolerance = 200

Distinct Categories = 7

Gage R&R

Source	VarComp	Standard Deviation	% Contribution	% Process	5.15 (SD)	% of Tolerance
Reproducibility	12070.77	109.8671	1.94 %	N/A	565.8154	282.91 %
Operator	1268.193	35.6117	0.20 %	N/A	183.4002	91.70 %

ILC Measurement Warp Industrial D1683
Oct. 31, 2002

Lab "2" Warp
Historic Std. Dev. = N/A
Tolerance = 200
Distinct Categories = 7

Gage R&R

<u>Source</u>	<u>VarComp</u>	<u>Standard Deviation</u>	<u>% Contribution</u>	<u>% Process</u>	<u>5.15 (SD)</u>	<u>% of Tolerance</u>
Sample Operator	<u>4468.577</u>	<u>66.84742</u>	<u>0.72 %</u>	<u>N/A</u>	<u>344.2642</u>	<u>172.13 %</u>
Replicate	<u>6334.002</u>	<u>79.58644</u>	<u>1.02 %</u>	<u>N/A</u>	<u>409.8702</u>	<u>204.94 %</u>
Repeatability	<u>11641.68</u>	<u>107.8966</u>	<u>1.87 %</u>	<u>N/A</u>	<u>555.6677</u>	<u>277.83 %</u>
Test Portion	<u>11641.68</u>	<u>107.8966</u>	<u>1.87 %</u>	<u>N/A</u>	<u>555.6677</u>	<u>277.83 %</u>
Total Gage R&R	<u>23712.45</u>	<u>153.9885</u>	<u>3.81 %</u>	<u>N/A</u>	<u>793.0407</u>	<u>396.52 %</u>
Sample	<u>599311.8</u>	<u>774.1523</u>	<u>96.19 %</u>	<u>N/A</u>	<u>3986.885</u>	<u>1993.44 %</u>
Total Study	<u>623024.3</u>	<u>789.3189</u>	<u>100.00 %</u>	<u>N/A</u>	<u>4064.992</u>	<u>2032.50 %</u>

ASTM International takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM International Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, at the address shown below.

This standard is copyrighted by ASTM International, 100 Barr Harbor Drive, PO Box C700, West Conshohocken, PA 19428-2959, United States. Individual reprints (single or multiple copies) of this standard may be obtained by contacting ASTM at the above address or at 610-832-9585 (phone), 610-832-9555 (fax), or service@astm.org (e-mail); or through the ASTM website (www.astm.org).